## Appendix B

## Road Safety Review Photo Log

Prepared by: TranSystems

Field Visit Date: April 9, 2019






Haligus Rd & Ackman Rd, SE Corner Critical foreslope and unfavorable ditch section



**Lakewood Rd & Ackman Rd, SE Corner**Utility pole guy wire in clear zone



Ronan Ct & Ackman Rd
No crosswalk pavement markings, worn ADA tiles (TYP)

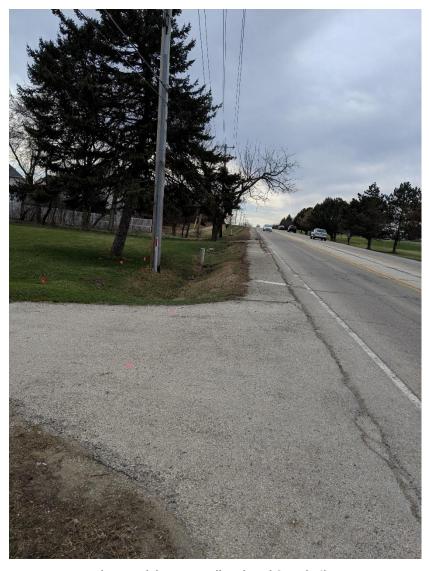

Ackman Rd, between Albrecht Rd & Redtail Dr Critical/Non-Recoverable foreslope potentially extends clear zone to hazards (utility poles, trees)



Ackman Rd, between Albrecht Rd & Redtail Dr Damaged EOP



Ackman Rd, between Albrecht Rd & Redtail Dr Non-traversable culvert end section with steep grades and eroded ground



Ackman Rd, between Albrecht Rd & Redtail Dr Non-traversable culvert end section with steep grades and eroded ground



**Redtail Dr & Ackman Rd**Edge of pavement damaged at corner radii



**Redtail Dr & Ackman Rd**Edge of pavement damaged at corner radii



Redtail Dr & Ackman Rd Edge of pavement damaged



Ackman Rd, between Redtail Dr & Swanson Rd Guardrail limits do not cover length of need for culvert and foreslope hazards.



Ackman Rd, between Redtail Dr & Swanson Rd Terminals do not meet current standards.



Ackman Rd, between Redtail Dr & Swanson Rd Non-recoverable, unprotected foreslope on approach to culvert hazard



Ackman Rd, between Redtail Dr & Swanson Rd Non-recoverable, unprotected foreslope adjacent to culvert hazard



Ackman Rd, between Swanson Rd & Huntley Rd (and other locations)
Undersized grate on culvert end section



**Huntley Rd & Ackman Rd** Edge of pavement damaged at corner radii



**Huntley Rd & Ackman Rd** Edge of pavement damaged at corner radii




Huntley Rd & Ackman Rd

Off-road tire marks observed, starting at approximately 30 ft east of the intersection of Huntley Rd & Ackman Rd . Possibly from loss of control during a southbound left-turn maneuver.



Ackman Rd, between Huntley Rd & Amberwood Rd Non-traversable culvert end section in clear zone

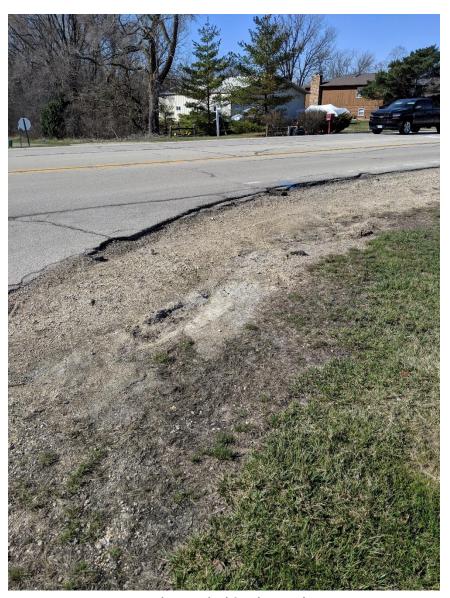

Amberwood Rd & Ackman Rd Edge of pavement damaged at corner radii



Ackman Rd, between Huntley Rd & Amberwood Rd
Steep foreslope and abrupt grading around drainage structure not flush
with adjacent ground



Golf Course Rd & Ackman Rd
Intersection pavement in poor condition (pot holes, depressions and pavement cracking)



Golf Course Rd & Ackman Rd
Intersection pavement in poor condition (pot holes, depressions and pavement cracking)



Golf Course Rd & Ackman Rd

Edge of pavement damaged at corner radii and Intersection pavement in poor condition (pot holes, depressions and pavement cracking)



Golf Course Rd & Ackman Rd

Edge of pavement damaged at corner radii and Intersection pavement in poor condition (pot holes, depressions and pavement cracking)



Golf Course Rd & Ackman Rd

Excessive glare and poor signal visibility during sunrise and sunset




Golf Course Rd & Ackman Rd
Non-functional push button in SW corner



**Golf Course Rd & Ackman Rd**ADA ramp tiles located within pavement limits in NW corner



Golf Course Rd & Ackman Rd
Non-traversable culvert end section in clear zone

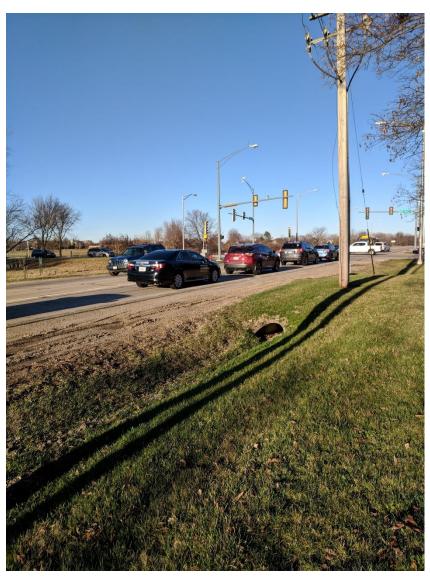


Golf Course Rd & Ackman Rd
Utility pole and non-traversable culvert end section potentially within clear zone



Ackman Rd, between Golf Course Rd & Westport Ridge
Utility pole and non-traversable culvert end section potentially within clear
zone



Ackman Rd, between Golf Course Rd & Westport Ridge
Bike Connectivity: Multiuse path terminates to sidewalk on midblock,
short of bike lanes on Golf Course Rd

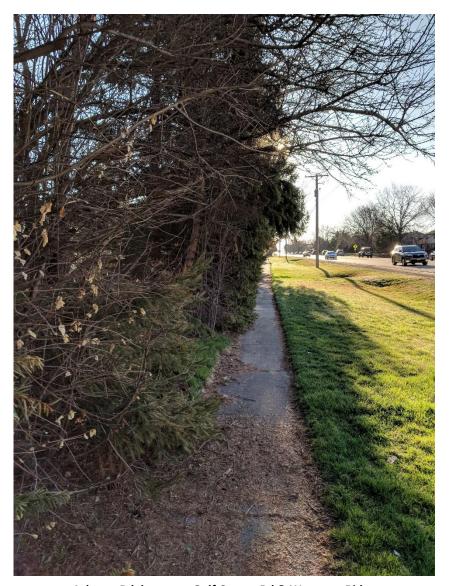

Ackman Rd, between Golf Course Rd & Westport Ridge
Overgrown vegetation encroaches on sidewalk, ADA compliant width not available



Ackman Rd, between Golf Course Rd & Westport Ridge

Non-traversable culvert end section in clear zone (remove obsolete
driveway)




Ackman Rd, between Golf Course Rd & Westport Ridge
Non-traversable culvert end section in clear zone (remove obsolete
driveway)



Westport Ridge & Ackman Rd

Excessive glare observed during sunrise and sunset hours at mid-block crossing equipped with rectangular rapid-flashing beacon, limiting the visibility of the signs and flashing beacons.

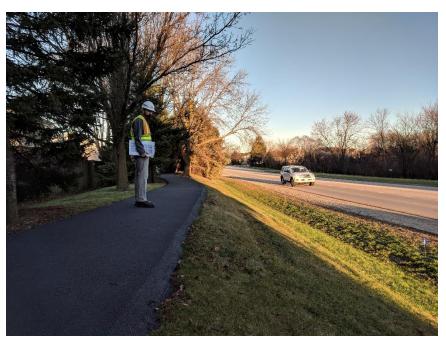

Ackman Rd, between Westport Ridge & Crimson Dr Non-recoverable foreslope adjacent to multi-use path



Ackman Rd, between Westport Ridge & Crimson Dr Non-traversable drainage structure in clear zone



Ackman Rd, between Westport Ridge & Crimson Dr Non-traversable culvert end section in clear zone



**Crimson Dr & Ackman Rd**Non-breakaway light pole in clear zone



**Crimson Dr & Ackman Rd**Broken curb at NW corner radius



Ackman Rd, between Skyridge Dr and Randall Rd Remove incorrect application of lane drop (W4-2) sign



**General Notes:** Edge of pavement on Ackman Rd Damaged or broken at various segments adjacent to gravel shoulders



**General Notes:** Various non-traversable drainage structures with eroded ground



**General Notes:** Various non-traversable drainage structures with undersized or missing grates within clear zone



**General Notes:** Various non-traversable culvert end sections not flush with adjacent ground